

Annual Inspection

Sturmer Parish Council

Pocket Park

Water Lane, Sturmer, Essex, CB9 7XF















Wicksteed Leisure Limited, Digby Street, Kettering, Northamptonshire, NN16 8YJ

www.wicksteed.co.uk

01536 517028 customerservices@wicksteed.co.uk





RPII Inspection Methodology

This document outlines the RPII position on inspections undertaken by the Inspectors listed on the RPII Register of Inspectors for Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, including ancillary items).

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 - Free access multi-sports equipment

BS EN 14974 - Skateparks

BS EN 16630 - Permanently installed outdoor fitness equipment

BS EN 16899 - Parkour equipment (plus RPII/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to 3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to wear and vandalism. Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be assessed using the inspector's knowledge and experience of the standards named in this document to ensure as far as is reasonably practicable the continued safe use of the items concerned. The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no aboricultural or horticultural assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.





Table 1

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection recommendations of relevant standards Refer to relevant standards for full text	Annual Main	RPII Annual Outdoor/ Fully enclosed Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	✓	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	~	✓ [3]
6.1 d) Effects of weather	✓	✓
6.1 d) Presence of rot, decay or corrosion (see note 1)	✓	✓ [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	✓	✓ [4]
6.1 d) Excavation or dismantling/additional measures	✓	×
6.2.1 Assessment of glass reinforced plastics (see note 5)	✓	✓ [5]
6.2.1 Inspection of one post equipment (see note 1)	✓	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	✓	×

NB: The clause numbers in table 1 are taken from BS EN 1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall Annual Main Inspection as detailed in the relevant standards.

- [1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.
- [2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.
- [3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.
- [4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance
- [5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.

Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity						
	,		Severity>>						
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)	
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)	
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)	
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)	
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)	
				Very Low	Low	Moderate	High	Very High	
	- SINCE 1918 -			1	2	3	4	5	
				No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality	
			Severity>>						

Note 1: The total risk scores included within our reports are a multipication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).

Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.




Wicksteed Leisure Limited Digby Street Kettering Northamptonshire NN16 8YJ +44 (0)1536 517028

Pocket Park

Inspection Ref: 1389187 Site Ref: 81103 Customer Order: 1255153-414121

Inspected: 8-June-2021 - 05:07 by Chris Newell

Risk Assessment: 12 Moderate Risk

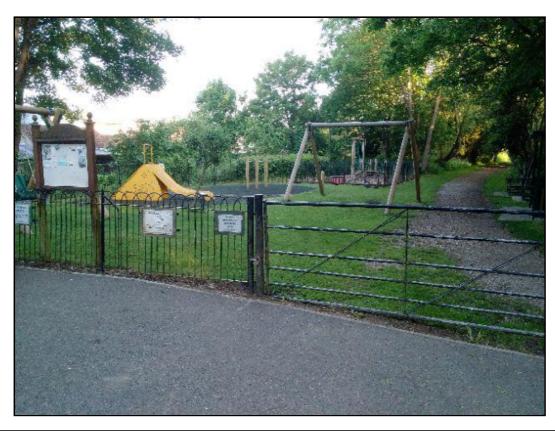

Location:

The site is located in an area of public open space and is not directly overlooked by any properties in the local community.

Disabled Access:

Generally accessible; an area accessible to most.







Item:Playground SignManufacturer:Not Applicable

Surface Type: N/A Item Quantity: 1 Equipment Compliance: N/A Surface Area Compliance: N/A

Total Findings: 1



Finding 1

It is recommended that signage, with information including the site address, contact information for maintenance issues and emergency contact details are provided for the facility - Provide in accordance with the recommendations



4 - Very Low Risk

Item: Gate - Maintenance

Manufacturer:UnknownSurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:Yes

Total Findings: 1



Finding 1

This item is satisfactory - no work required -







Item:FenceManufacturer:UnknownSurface Type:N/AItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



12 - Moderate Risk

Item:Dog Litter BinManufacturer:UnknownSurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

Parts of the steel on this item have corroded excessively and the metal has perforated in places - Ensure all affected areas are treated and repaired







Item:Litter BinManufacturer:UnknownSurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:Yes

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



4 - Very Low Risk

Item:ShelterManufacturer:UnknownSurface Type:Concrete

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:Yes

Total Findings: 1



Finding 1

This item is satisfactory - no work required -







🎧 4 - Very Low Risk

Picnic Table Item: Manufacturer: Unknown **Surface Type:** Concrete

Item Quantity: 1 **Equipment Compliance:** N/A Surface Area Compliance: Yes

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



4 - Very Low Risk

Item: Picnic Table Manufacturer: Unknown **Surface Type:** Concrete

Item Quantity: 1 **Equipment Compliance:** N/A Surface Area Compliance: Yes

Total Findings: 1



Finding 1

This item is satisfactory - no work required -







Item:SeatManufacturer:UnknownSurface Type:Paving Slabs

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:Yes

Total Findings: 1



Finding 1

The paving surface under or around this unit has been damaged - Monitor for any further deterioration and repair as required



6 - Low Risk

Item: 1 Bay Mixed Seat, 1 Cradle, 1 Flat

Manufacturer: Unknown

Surface Type: Grass Matrix Tiles

Item Part Number: 2.4m Timber Swing

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/ATotal Findings:2



Finding 1

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

Finding 2

There is no identification label affixed to the equipment - Provide an identification label







6 - Low Risk

Parallel Bars Item: Manufacturer: Unknown

Surface Type: EcoScape Softbond

Item Quantity: 1 **Equipment Compliance:** Yes Surface Area Compliance: Yes

Total Findings: 2



Finding 1

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will Provide an identification label accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

Finding 2

There is no identification label affixed to the equipment -



4 - Very Low Risk

Item: Slide Unit Manufacturer: Unknown

Surface Type: EcoScape Softbond

Item Part Number: 2.0m Slide with climbing ramp access

Item Quantity: 1 **Equipment Compliance:** Yes Surface Area Compliance: Yes **Total Findings:** 1



Finding 1

There is no identification label affixed to the equipment - Provide an identification label







6 - Low Risk

Item: 1 Bay Swing
Manufacturer: Unknown

Surface Type: Grass Matrix Tiles

Item Part Number: 2.1m Timber Swing, bucket seat fitted

Item Quantity: 1

Equipment Compliance: Yes
Surface Area Compliance: Yes
Total Findings: 2



The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability



Finding 2

There is no identification label affixed to the equipment - Provide an identification label



4 - Very Low Risk

Item: Fence - Bow Top

Manufacturer:UnknownSurface Type:N/AItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -







Item:FenceManufacturer:UnknownSurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



5 - Very Low Risk

Item: Gate - Pedestrian

Manufacturer:UnknownSurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:Yes

Total Findings: 1



Finding 1

The gate is not operating correctly - Take effective action to ensure the gate closes between 4 and 8 seconds







6 - Low Risk

Item:Swinging StepsManufacturer:Sovereign Leisure

Surface Type: Woodchip

Item Quantity:1Equipment Compliance:YesSurface Area Compliance:Yes

Total Findings: 1



Finding 1

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability



6 - Low Risk

Item:Suspension BridgeManufacturer:Sovereign Leisure

Surface Type: Woodchip

Item Quantity:1Equipment Compliance:YesSurface Area Compliance:Yes

Total Findings: 1



Finding 1

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability





Findings information



Item: Signs - Playground Sign

Manufacturer: Not Applicable



Finding: It is recommended that signage, with information including the site address, contact information for maintenance issues and emergency contact details are provided for the facility

Risk Level: V - Very Low Risk

Surface: N/A

Risk Level:



Action: Provide in accordance with the recommendations

M - Moderate Risk

12 - Moderate Risk (Finding 1)

Item: Ancillary Items - Dog Litter Bin

Manufacturer: Unknown Surface: Grass



Finding: Parts of the steel on this item have corroded excessively and the metal has perforated in places



Action: Ensure all affected areas are treated and repaired







Item:Ancillary Items - SeatRisk Level:V - Very Low RiskManufacturer:UnknownSurface:Paving Slabs





Finding: The paving surface under or around this unit has been damaged

Action: Monitor for any further deterioration and repair as required





Item: Swings - 1 Bay Mixed Seat, 1 Cradle, 1 Risk Level: L - Low Risk

Manufacturer: Unknown Surface: Grass Matrix Tiles









Finding: The timber has a number of splits/shakes or air **Action:** Monitor to ensure the splits do not cross through cracks and this may affect the stability or allow water ingress fixing points of the structure and/or cause any instability which will accelerate the rotting process







0 - Risk Assessment not Undertaken (Finding 2)

Item: Swings - 1 Bay Mixed Seat, 1 Cradle, 1

Flat

Manufacturer: Unknown

Risk Level: N - Risk Assessment not Undertaken

Surface: Grass Matrix Tiles



NO IMAGE APPLICABLE

Finding: There is no identification label affixed to the

equipment

Action: Provide an identification label

i

6 - Low Risk (Finding 1)

Item:Activity Equipment - Parallel BarsRisk Level:L - Low RiskManufacturer:UnknownSurface:EcoScape Softbond





Finding: The timber has a number of splits/shakes or air **Action:** Monitor to ensure the splits do not cross through cracks and this may affect the stability or allow water ingress fixing points of the structure and/or cause any instability which will accelerate the rotting process







0 - Risk Assessment not Undertaken (Finding 2)

Item: Activity Equipment - Parallel Bars

Manufacturer: Unknown



Finding: There is no identification label affixed to the equipment

Risk Level: Surface:

N - Risk Assessment not Undertaken

EcoScape Softbond



Action: Provide an identification label

(1)

4 - Very Low Risk (Finding 1)

Item: Other - Slide Unit
Manufacturer: Unknown



Finding: There is no identification label affixed to the equipment

Risk Level: V - Very Low Risk **Surface:** EcoScape Softbond



Action: Provide an identification label





Item:Swings - 1 Bay SwingRisk Level:L - Low RiskManufacturer:UnknownSurface:Grass Matrix Tiles







Finding: The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress fixing points of the structure and/or cause any instability which will accelerate the rotting process







4 - Very Low Risk (Finding 2)

Item: Swings - 1 Bay Swing


Manufacturer: Unknown



Finding: There is no identification label affixed to the

equipment

Risk Level: V - Very Low Risk **Surface:** Grass Matrix Tiles

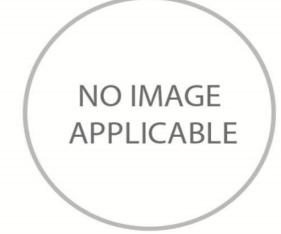

Action: Provide an identification label



5 - Very Low Risk (Finding 1)

Item: Gates - Gate - Pedestrian

Manufacturer: Unknown

Risk Level: V - Very Low Risk Surface: Grass



Finding: The gate is not operating correctly




Action: Take effective action to ensure the gate closes between 4 and 8 seconds





cracks and this may affect the stability or allow water ingress fixing points of the structure and/or cause any instability which will accelerate the rotting process



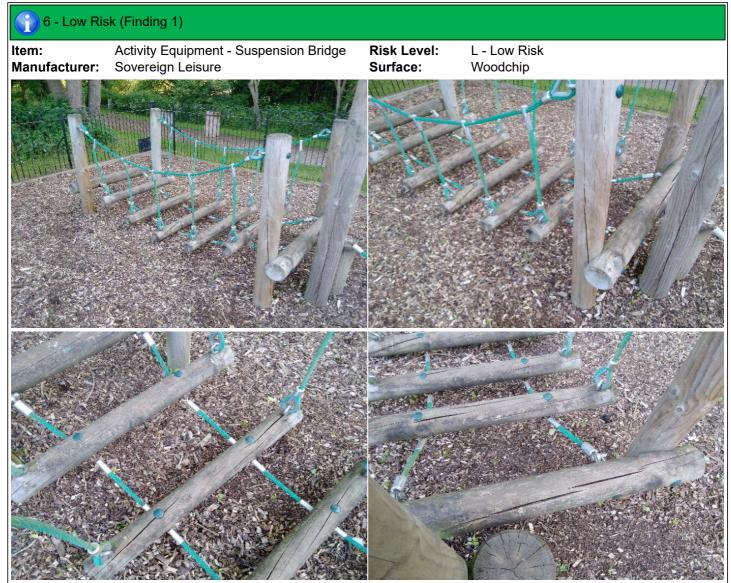

Finding: The timber has a number of splits/shakes or air Action: Monitor to ensure the splits do not cross through cracks and this may affect the stability or allow water ingress fixing points of the structure and/or cause any instability which will accelerate the rotting process